



مركز الطائر للحصن السيارات بالكسبوتر

التاريخ: 2026/7/12
الوقت: 11:33
رقم الشهادة: 387898
العدد: 2015
قوة السكنية: 92 %

1/ الزجاج الامامي مغفر جديد

2/ طرورية التوك في صوت

3/ شاسي تحت في صديق فار + في حلا بسيط

4/ اوير ككها قديمة 2022 تحتاج تديل

5/ صديق 2 صدام + رفوف ولب ارامي يمين صديق + شتطة على صديق وممبون بسيط
+ البودي في نر وخنوش بسيطة



12/7/2026

Bird Centre Cars Checking by Computer

BP2377 - CR. No. 1995 / P.O. Box 51848 Doha - Qatar



مركز الطائر لفحص السيارات بالكمبيوتر

تسجيل: ٢٢٥٨٣٣٣ / ص.ت: ١٩٩٥ / ص.ب: ٥١٨٤٨ الدوحة - قطر

Model: _____

Signature: _____


رقم التفتيش: 50562252

ملاحظات

رقم التفتيش: 47638

WIND SHIELD CLASS NEW
ABS MODULE NOISE
UNDER CHASSIS PAINTED ANTI-RUST
AND LITTLE CORROSION
BODY SMALL DENT AND LITTLE SCRATCH

التاريخ: 28/06/12
الوقت: 11:33
نوع الفحص: FULL CHECK
نوع السيارة: TOYOTA
الموديل: PRADO
سنة الموديل: 2016
رقم السيارة: 307096
إمرة التفتيش: 92
لجنة الفحص: 309

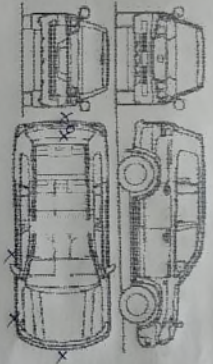

التوقيع

التفتيش

اسم العميل

Note: Bird Center is not responsible for any result show after receiving the test result and exit the car from the center

مركز الطائر غير مسؤول عن أي نتيجة تظهر بعد استلام نتيجة الفحص وخروج السيارة من المركز



www.audit.com MaxCOM M858

Page 1

Shop Name: THE BIRD CAR CENTER CHECKING BY COMPUTER
Tel: 47211143, 33615045, 77013769
Email: --
Address: SALWA ROAD, DOHA QATAR

Report ID: MAXIA2026071211195
Test Time: 2026-07-12 11:19:5
Technician:

3 Toyota VEHICLE DIAGNOSTIC REPORT

Vehicle Information
13/Toyota/Land cruiser prado/1GRFE
VIN: --

Odometer Reading: 117486km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiCOM MK808
Version: V11.20

Serial Number: DK7G80201462
Repair Order Number: --

System Scanned (19)

	Status/DTC
Engine and ECT	2
ABS/VSC/TRC	4
SRS airbag	0
Combination meter	0
Main body	8
Driver door motor	0
Sliding roof	0
Right rear door motor	1
Left rear door motor	0
Passenger door motor	0
Air conditioner	0
Navigation system	2
Starting control	0
Power source control	0
Adaptive front-lighting system (AFS)	1
Clearance sonar	1
Cruise control	0
Master switch	0
PPS	1

DTC (20)



www.autel.com

MaxiCOM MK808

Page

and ECT (2 DTCs)

DTC	Description	Status
P04	Startability fault	Current
P04	Startability fault	History

IS/VSC/TRC (4 DTCs)

DTC	Description	Status
C1201	Engine/EV control system malfunction	Current
C1241	Low or high power supply voltage	Current
C1256	Accumulator pressure low	Current
C1452	Accumulator pressure low	Current

Main body (8 DTCs)

DTC	Description	Status
B1273	Sliding roof electronic control unit(ECU) communication stop	History
B2322	P-door motor electronic control unit(ECU) communication stop	History
B2323	Rear door motor electronic control unit(ECU) communication stop	History
B2431	Right LED headlamp abnormal	History
U0155	Lost communication with instrument panel cluster (IPC) control module	History
U0163	Lost communication with navigation control module	History
U0327	Software incompatibility with vehicle security control module	History
U1133	Lost communication with PMN module	History

Right rear door motor (1 DTC)

DTC	Description	Status
B2312	Power window switch of right rear door fault	History

Navigation system (2 DTCs)

DTC	Description	Status
U1110	Clearance sonar electronic control unit(ECU) communication	History
C1622	Rear camera disconnected	History

Adaptive front-lighting system (AFS) (1 DTC)

DTC	Description	Status
B2425	Lost communication with right headlamp beam level control motor	History

Land cruiser prado/1GRFE

Test Time: 2026-07-12 11:19:57

Report ID: MAXIA2026071211195

sonar (1 DTC)

Description		Status
AD	Rear sensor communication circuit	History

S (1 DTC)

Description		Status
C1541	Vehicle speed signal	History

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Disclaimer: This report provides a reference for vehicle inspection and maintenance only. Autel is not liable for any accident, property damage, or personal injury resulting from the use of this information.



www.autel.com

MaxiCOM MK808

Page 5

THE BIRD CAR CENTER CHECKING BY COMPUTER
711143,33615045,77013769
SALWA ROAD, DOHA QATAR

Report ID: MAXIA20260712112241
Test Time: 2026-07-12 11:22:41
Technician: -

Toyota Vehicle Diagnostic Report

Vehicle Information

Model: Land Cruiser Prado

Model selection > Land Cruiser Prado > Europe/Other >
Others > 08/2013-08/2016 > Others > Without smart key >
Auto scan > Live data >

Odometer Reading: 117486 km
License Plate: -
Sub Model: -

Customer Information

Name: -

Tel: -

Device Information

Scanner: MaxiCOM MK808
Version: V11.70

Serial Number: DK7G80201462

Toyota
V11.70

☐	Vehicle speed	0	km/h
☐	Engine run time	367	s
☐	Throttle sensor position	0	%
☐	Throttle sensor voltage %	16.5	%
☐	Throttle sensor 2 voltage %	48.2	%
☐	Acceleration sensor 1 voltage %	15.7	%
☐	Acceleration sensor 2 voltage %	22.2	%

THE BIRD CAR CENTER CHECKING BY COMPUTER
114333615045,77013769
SALWA ROAD, DOHA QATAR

Report ID: MAXIA20260712112356
Test Time: 2026-07-12 11:23:56
Technician: -

Toyota Vehicle Diagnostic Report

Vehicle Information
Model: Land cruiser prado
Manual selection > Land cruiser prado > Europe/Others >
Others > 08/2013-08/2016 > Others > Without smart key >
Others > Auto scan > Live data >

Customer Information
Name: -
Tel: -

Device Information
Scanner: MaxiCOM MKB08
Version: V11.70
Serial Number: DK7G80201462

Toyota
v11.70

☐ Acceleration sensor 2 voltage %	32.2	%
☐ Throttle motor duty	16.5	%
☐ Warm-up cycle cleared diagnostic trouble code(DTC)	0	times
☐ Distance from diagnostic trouble code(DTC) cleared	0	km
☐ Time after diagnostic trouble code(DTC) cleared	1	min
☐ Battery voltage	13.085	V

Clear all data

www.maxicom.com MaxiCOM MKB08

Page 1

Shop Name: THE BIRD CAR CENTER CHECKING BY COMPUTER
Tel: 47711143,33615045,77013769
Email:
Address: SALWA ROAD, DOHA QATAR

Report ID: MAXIA20260
Test Time: 2026-07-1
Tech

2013 Toyota Vehicle Diagnostic Report

Vehicle Information

2013 Toyota/Land cruiser prado

VIN: --

Path: Manual selection > Land cruiser prado > Europe/Others >
gRJ > Others > 08/2013-08/2016 > Others > Without smart key >
Diagnosis > Auto scan > Live data >

Odometer Reading: 117486 km

License Plate: --

Sub Model: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiCOM MK808

Version: V11.70

Serial Number: DK7G80201462

Toyota
V11.70

☐ Calculate load	29	%
☐ Vehicle load	13.7	%
☐ Mass air flow (MAF)	4.01	gm/s
☐ Intake air	60	°C
☐ Atmosphere pressure	98	Kpa
☐ Coolant temperature	87	°C
☐ Engine speed	728	rpm

Exit Exit Merge Torque Setting Clear data Freeze Record Record Back

